


3 1 9 0 - 6 3 8 4

**EZ-195-QF-X**  
**3190-6384**




**QMA Female (Jack) Straight Non-Solder Pin No Braid Trim Connector for LMR-195 Cable**

Made in China

## Installation Instruction

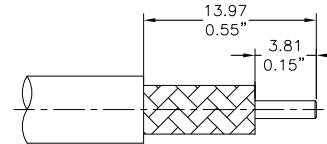

Recommended cable stripping dim's

 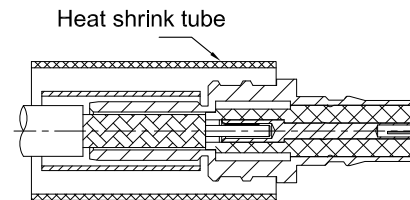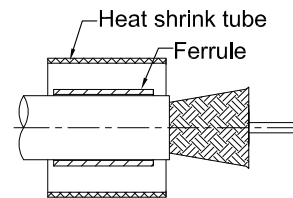

1. A. Trim cable to dimensions shown.  
Be careful to avoid nicking the inner and outer connector.

2. A. Slide crimp ferrule and heat shrink tube over the cable.  
B. Flare the braid.

3. A. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .216" HEX crimp tooling.  
Pay attention to the crimp area, do not crimp rear of crimp sleeve.

B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun.



Times supply rubber boot 3109-445 (WSB-195/200) as an option to instead of heat shrink tube.

Refer to [www.timesmicrowave.com](http://www.timesmicrowave.com) for install videos